Coast Guard, DHS § 174.050


§174.100(b) are not considered as openings through which downflooding could occur if they can be rapidly closed and would not be submerged below the units' waterline prior to the first intercept angle, except that ventilation intakes and outlets for machinery spaces, crew spaces, and other spaces where ventilation is normally required are considered as openings through

which downflooding could occur regardless of location.

(d) Each unit must be designed so that it can be changed from each of its normal operating conditions to a severe storm condition within a minimum period of time consistent with the operating manual required in §109.121 of this chapter.

## GRAPH 174.045

## Intact Stability Curves for a Given Normal Operating or Severe Storm Mode

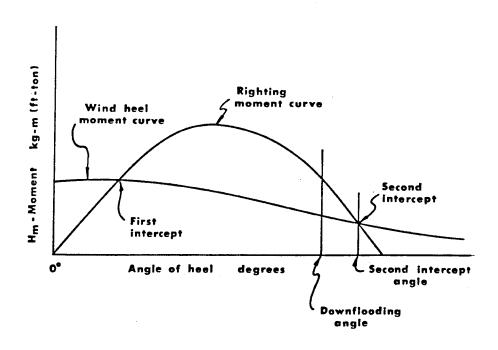

[CGD 79–023, 48 FR 51048, Nov. 4, 1983, as amended by CGD 83–071, 52 FR 6979, Mar. 6, 1987]

## §174.050 Stability on bottom.

Each bottom bearing unit must be designed so that, while supported on the sea bottom with footings or a mat,

it continually exerts a downward force on each footing or the mat when subjected to the forces of wave and current and to wind blowing at the velocities described in §174.055(b)(3).